

DRO 200T™

REFERENCE MANUAL

ACU-RITE®

Readout Parameter Access Code

An access code must be entered before machine-related parameters can be set or changed. This prevents inadvertent adjustments to the setup parameters.

IMPORTANT

The access code is 8891

Refer to the Setup section. Begin by pressing the **SETUP** key. When “SETUP” is displayed, press the **8**, **8**, **9**, **1**, and **ENTER** keys. The readout is now ready for machine parameter setting operations.

IMPORTANT

Supervisors may wish to remove this page from the Reference manual after initially setting up the readout system. Retain in a safe place for future use.

Warranty

ACU-RITE Products and accessories are warranted against defects in material and workmanship for a period of three years from the date of purchase. ACU-RITE will, at its option and expense, repair or replace any part of the ACU-RITE product that fails to meet this warranty. This warranty covers both materials and factory labor. In addition, authorized ACU-RITE service representatives will provide service labor (field service) for a period of one year at no charge. Notice of the claimed defect must be received by ACU-RITE within the warranty period.

This warranty applies only to products and accessories installed and operated in accordance with this reference manual. ACU-RITE shall have no obligation, with respect to any defect or other condition caused in whole or part by the customer's incorrect use, improper maintenance, modification of the equipment, or by the repair or maintenance of the product by any person except those deemed qualified by ACU-RITE.

Responsibility for loss of operation or diminished performance due to conditions beyond ACU-RITE's control cannot be accepted by ACU-RITE.

The foregoing warranty obligations are in lieu of all expressed or implied warranties. ACU-RITE INCORPORATED shall not be liable under any circumstances for consequential damages.

30 Day Red Carpet Warranty

All ACU-RITE products are covered by a 30-day Red Carpet Warranty. If in the first 30 days this product fails for any reason, repack it in the original packing materials and contact your Authorized ACU-RITE Distributor for return procedures.

Introduction	1
A Tour of the Readout.....	1
Front and Back Views.....	1
Keypad	2
Displays.....	3
Power-On Position Recovery	4
Position-Trac	4
Readout Operations.....	5
Clear Key	5
Absolute and Incremental Displays	5
Absolute Display	5
Incremental Display	5
Radius/Diameter Display	6
Zeroing the Displays	7
Absolute Zero	7
Incremental Zero.....	10
Presetting	11
Absolute and Incremental Presets.....	12
Near Zero Warning	12
Tool Offset.....	13
Defining Tools with the Auto-Offset Calculation Feature.....	13
Defining Tools with a Tool Presetter	15
Setup	16
Machine-Related Setup Parameters	16
Count Direction.....	16
Encoder Resolution	16
Job Setup Parameters.....	17
Display Resolution.....	17
Scale Factor	17
Near Zero Warning.....	17
Tool Offset Definition	17
Linear Error Compensation.....	18
Installation	19
Readout Specifications	22
Troubleshooting	23



This symbol alerts you to the fact that important information concerning the installation and operation of this readout has been included in this manual.

Keep these instructions in a secure place for future reference.


Introduction

ACU-RITE's DRO 200 readout series provides application-specific features required for you to obtain the most productivity from your manual machine tools.

The DRO 200T is designed specifically for turning applications. Special features include radius/diameter conversion, a tool offset library, and an axis lock feature.

A Tour of the Readout

Front and Back Views

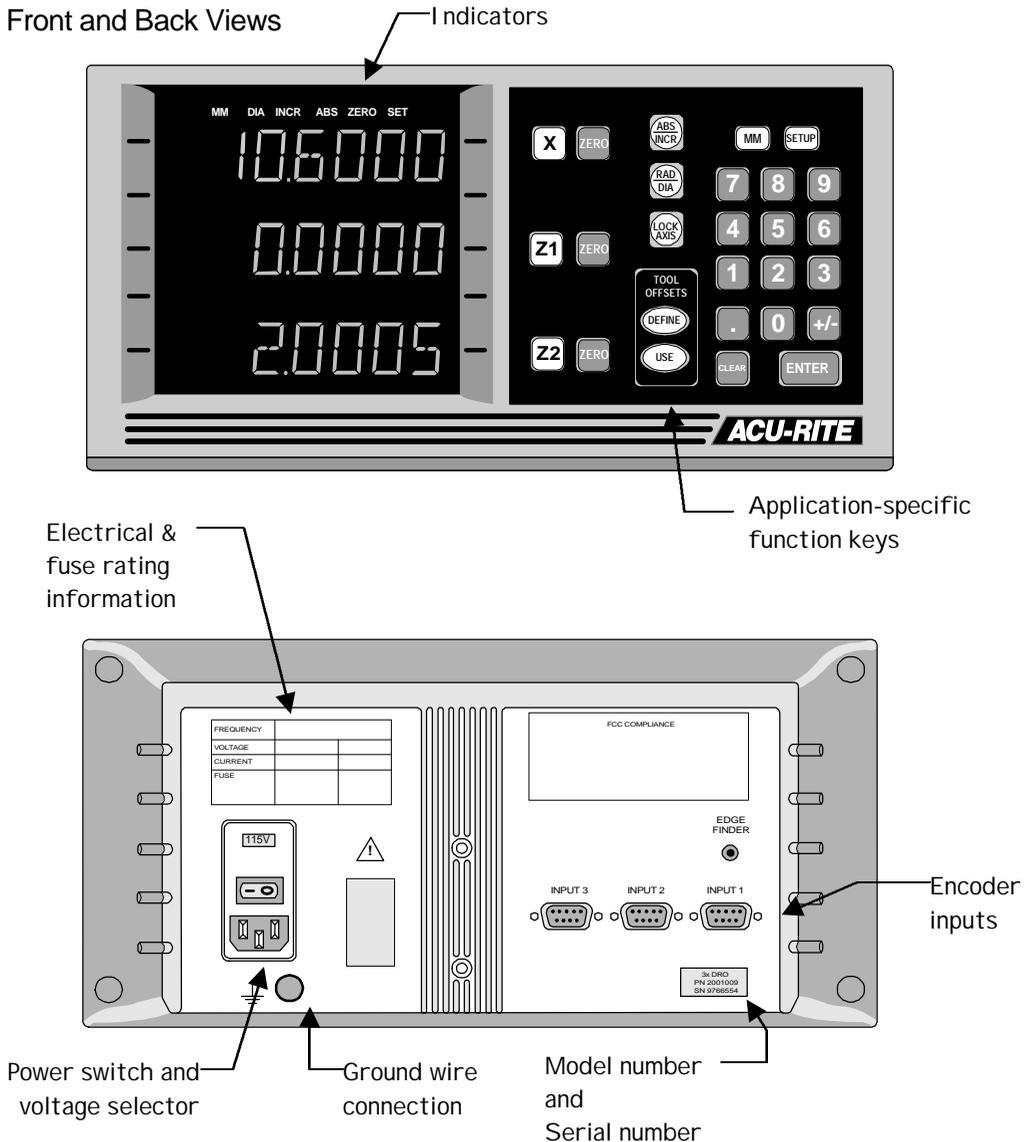

Indicators

Application-specific function keys

Electrical & fuse rating information

Encoder inputs

Power switch and voltage selector

Ground wire connection

Model number and Serial number

Keypad

Selects absolute or incremental display



English / metric conversion



System setup parameters


Selects radius or diameter display



Locks the display so you can move the tool without losing position



Enter all numeric values with these

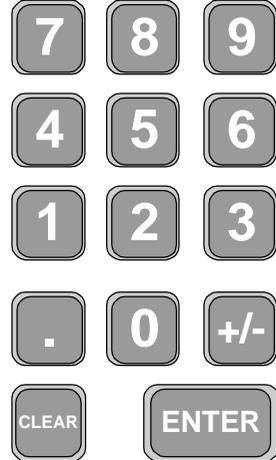

Begin a preset




Zero an axis display



Lets you define a library of tool offsets, and select which offset to use

Displays

At the top of the display window is a row of indicators. These tell you the current state of the readout.

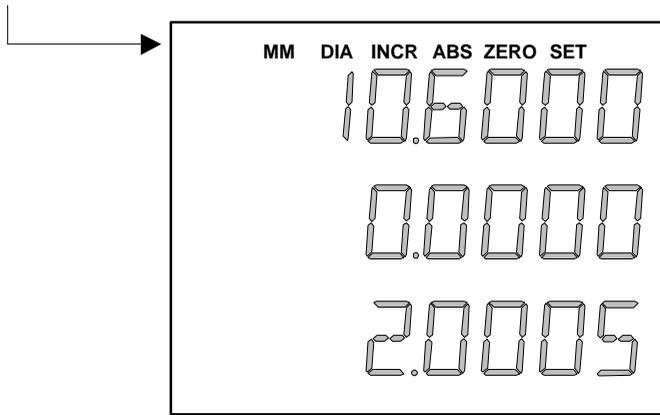**ZERO**

Appears when setting an absolute zero.

SET

Lets you know when you are setting a preset or an absolute zero.

DIA

Tells you when the crossfeed axis is displaying the part's diameter.

MM

Appears when you're positioning in metric, dark when you're positioning in inches.

INCR ABS

These tell you if the position display is incremental or absolute. They also refer to the type of preset.

In addition to the lighted indicators along the top of the display, the top axis display will scroll longer messages that will help you step through some of the procedures.

Power-On Position Recovery

Position-Trac

Certain ACU-RITE encoders, such as the ENC 150, contain closely-spaced reference marks that enable the display to show the correct position after a power interruption. The readout will indicate when power has been lost, and will prompt you to move each axis until a reference mark is located. By traversing the reference marks once in each axis, you will re-establish the display position relative to the last known zero. The most you will ever have to move an axis is about one inch. You must move in a positive count direction. A flashing decimal point will indicate that the last position has not been recalled.

If you use an encoder that does not have the Position-Trac feature, the procedure for recovering your position is slightly different. Reference marks on these encoders are about 8" apart. You must find a convenient reference mark and then use the same mark every time.

1. Move near the desired reference mark.
2. Press and hold the  key until the decimal point starts to flash.
3. Move slowly past the reference mark until the readout recalls its position. You must move in a positive direction.

Readout Operations


Clear Key

Use the  key to erase digits that you entered by mistake, or to take you back if you've pressed a wrong function key.

Absolute and Incremental Displays


Absolute Display

Shows the distance from your current position to *absolute zero*.

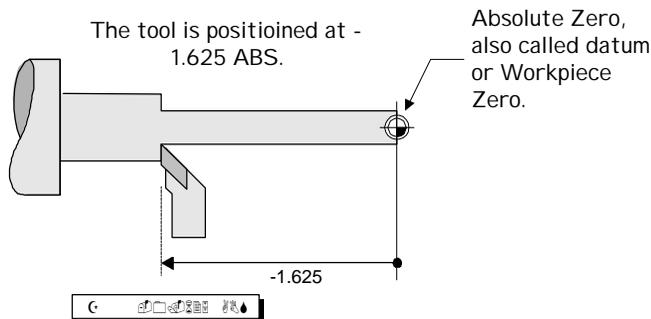

Incremental Display

Shows the distance from your current position to *incremental zero*. An incremental zero is set when you preset a dimension, or when you zero the incremental display.

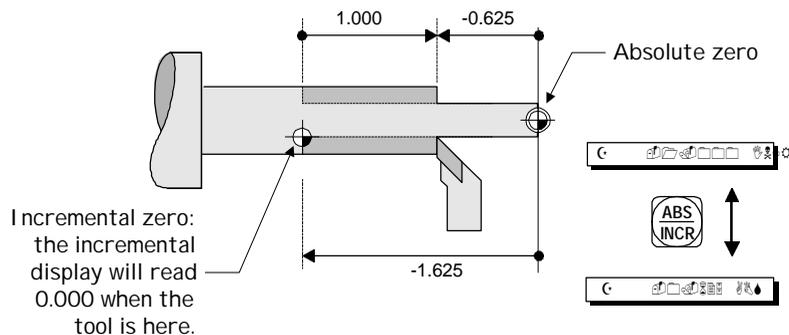


Automatic Display Switching

Sometimes the readout will switch from one display to another automatically. When you enter a preset, for example, the display switches to the incremental display so you can move to zero. Whenever the readout does an automatic display switch, INCR will appear in the display.

Radius/Diameter Display


Pressing the  key lets you view a workpiece dimension either as a radius or as a diameter.

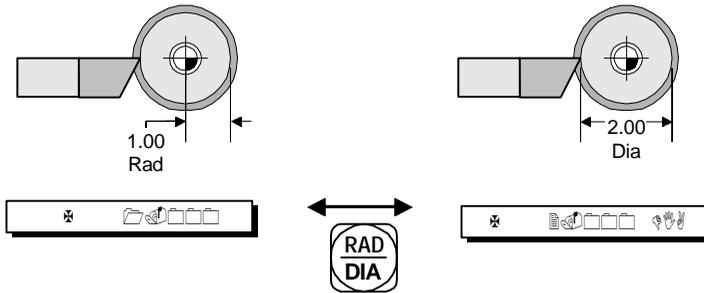

Zeroing the Displays


Absolute Zero

On many prints, the dimensions are measured from one or two surfaces of the part. By setting the readout's absolute display to zero at a well-chosen surface, you can enter the part's dimensions directly from the print, using absolute presets.

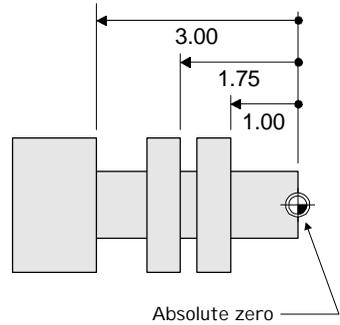

Setting Absolute Zero at the Current Position


1. Move to desired location.
2. Make sure that the absolute position is displayed.
3. Zero the appropriate axis.



Setting Absolute Zero with a Tool

Longitudinal Axis


1. Touch the tool to the face of the workpiece.
2. Make sure that the absolute position is displayed.
3. Press the ZERO key for the appropriate axis.

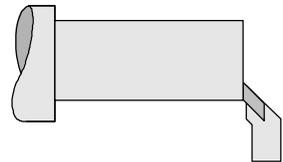


4. Enter the tool position.



If you want the absolute zero to be on the face of the workpiece:

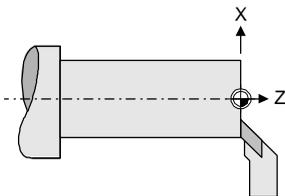


If you want the absolute zero to be offset from the face of the workpiece:

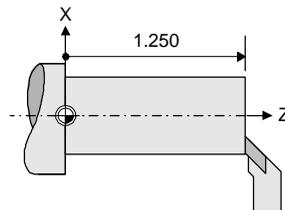

Crossfeed Axis

1. Touch the tool to the diameter of the workpiece.

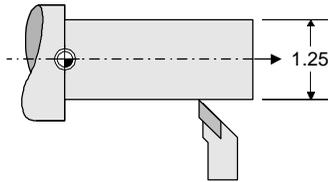

2. Make sure that the absolute position is displayed.



ABS

3. Press the  key for the appropriate axis.



4. Enter the tool position—either as a radius or as a diameter, depending on the display.



Setting Absolute Zero with the Tool under Load


Longitudinal Axis

1. Make sure that the absolute position is displayed.



ABS


2. Machine the face of the workpiece.

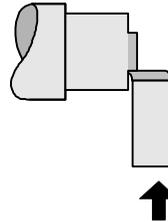

3. While the tool is still contacting the workpiece, press the ZERO key for the appropriate axis, then the LOCK AXIS key. The readout will lock this tool position in the display, even if you move the tool.



4. Move the tool away and measure the face location, if required .

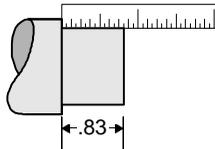



5. Enter the face location.



If you want zero on the face of the workpiece



If you want zero offset from the face of the workpiece

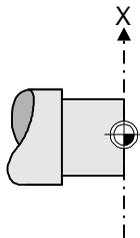


Crossfeed Axis

1. Make sure that the absolute position is displayed.




ABS

2. Machine the diameter.

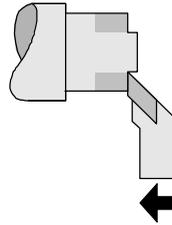

3. While the tool is still contacting the workpiece, press the  key for the appropriate axis, then the  key. The readout will lock this tool position in the display, even if you move the tool.


4. Move the tool away and measure the diameter.

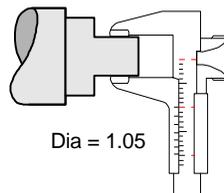

5. Enter the diameter.



This puts the zero on the workpiece centerline




Incremental Zero

From the readout incremental display, press the  key. This sets the incremental display to zero at the current tool position.


Presetting

When you preset a dimension, the readout places an incremental zero at the location you specify. Then, the display automatically switches to the incremental display so you can move to zero.

Begin a preset by pressing an axis key (**X** for example). The information from the previous preset will appear. The display will show you if the preset is absolute or incremental. Use the **ABS/INCR** key to change from one to the other. Then enter the dimension you want to preset.

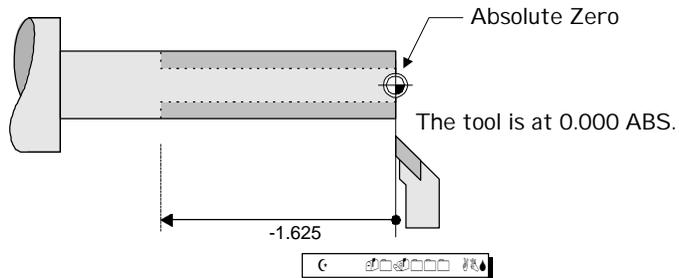


To preset the absolute location of the shoulder:



Display automatically switches to incremental.




Absolute display reads zero.

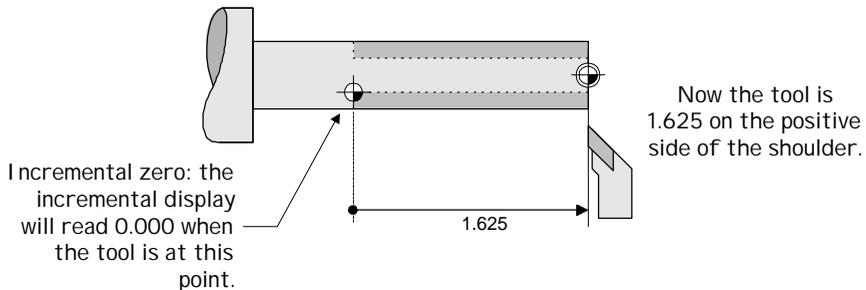



Absolute and Incremental Presets

To maintain the best tolerance and to minimize the chance for errors, use


- absolute presets for absolute dimensions
- incremental presets for incremental dimensions.

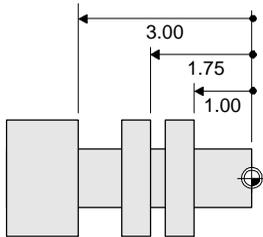

When you enter an absolute preset, it **does not matter** where the tool position is. The DRO 200T calculates the desired location automatically.

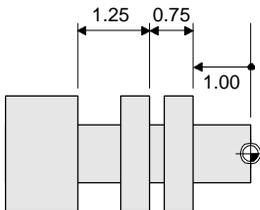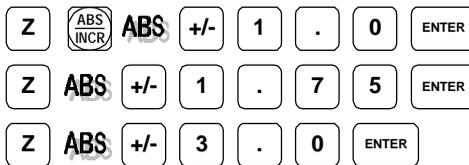


When you enter an incremental preset, the tool **must** be positioned at the location you are dimensioning from.

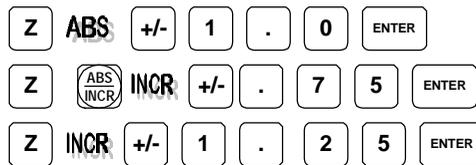

Near Zero Warning

When you are moving to zero, the readout can “warn” you when you are getting close. This allows you to machine faster and avoid overshooting your desired location.


You can set the near zero range in Setup.

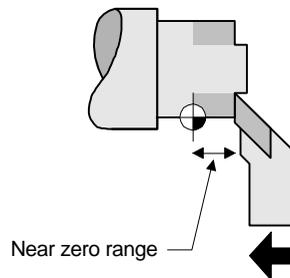

The digits displayed to the left of the decimal point will flash.

Tool Offset

The DRO 200T can store the dimensional offsets for up to 10 tools. When you change a workpiece and establish the absolute zero, all the tools are automatically referenced from the new zero.

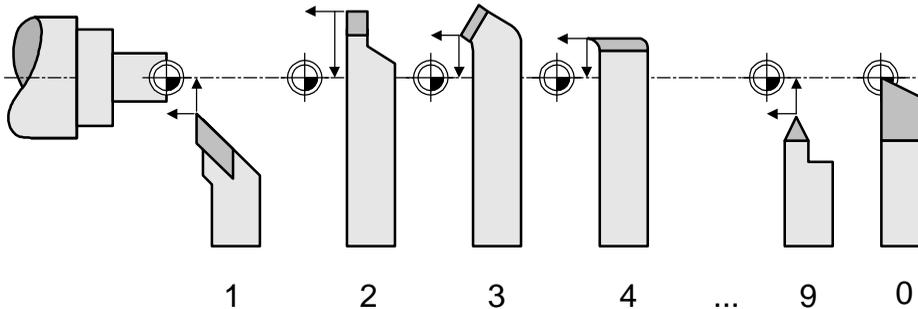

The offset dimensions can be found using a tool presetter, or you can determine them using the *auto-offset calculation* feature of the readout. In Setup you determine which method you wish to use.

Defining Tools with the Auto-Offset Calculation Feature


1. Install a tool and select its number.



2. Begin the tool offset definition.




3. Machine a diameter.

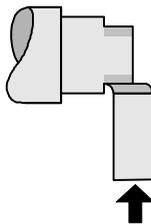

4. While the tool is still in contact with the workpiece, press the  key. The readout will lock this tool position into the display, even if you move the tool.


5. Move the tool away from the workpiece and measure the diameter of the workpiece.

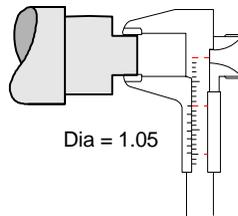


6. Select the axis and enter the measured value.



7. Press the define key again, and make a face cut.

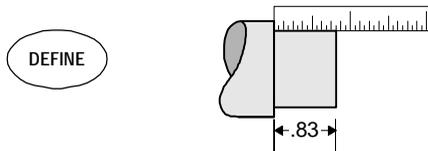

8. While the tool is still in contact with the workpiece, press the  key.
9. Move the tool away from the workpiece, and measure the length of the shoulder.

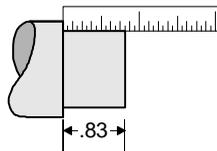

10. Select the axis and enter the measured value.




Defining Tools with a Tool Presetter


Use a tool presetter to obtain offsets in X and Z for your tools.

If you wish, you may select a tool to be a *reference* tool. Then you can use a tool presetter to obtain the differences, in X and Z, between the reference tool and the other tools.

The reference tool does **not** have to be Tool 0, and its offset values do not have to be 0,0

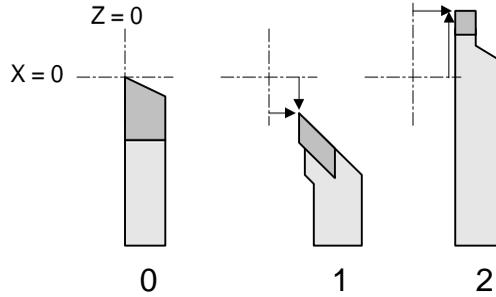

Then, select each tool and define its offset.

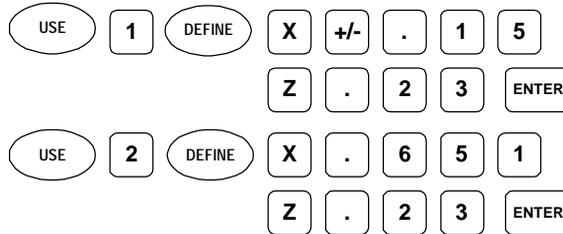

Setup

The **SETUP** key lets you change the system parameters. Some of these parameters are job related, meaning that they may change from job to job. Others are machine related and should be set as part of the installation. The machine-related parameters can be accessed by pressing:



Use the **X** key to move from one parameter to the next. After the last parameter, the **X** key ends the setup process and saves any changes. Use the **CLEAR** key to move back to a previous parameter.

Some parameters have choices. Use the **Z** key cycle through the available choices.

At any time during setup, pressing the **SETUP** key will end the setup process and save the changes.

Machine-Related Setup Parameters

Count Direction

This determines which way is positive. Move each axis in the positive count direction. The display will show a 1 or a 2 depending on count direction. You can also change the count direction by pressing the **Z** key.

Encoder Resolution

Move each encoder until the readout senses and displays the resolution. You won't have to move more than two inches. For scales without Position-Trac, you need to enter the encoder resolution. You can press the **Z** key to select from common choices, or you can use the keypad to enter the resolution directly.

Job Setup Parameters

Display Resolution

The display resolution will be the same as the encoder resolution. If the job tolerance is coarser than the encoder resolution (± 0.005 for example), you can adjust the display resolution so you won't be tempted to waste time by machining to a finer resolution. Use the **Z** key to cycle through all the possible choices. The choices available depend upon the resolution of the encoders.

Scale Factor

You can define a scale factor for each axis. The typical scale factor is 1.000, which means that the displayed dimensions are the actual part dimensions. A scale factor less than 1 causes the part to be smaller than the print dimensions; a scale factor greater than 1 causes the part to be larger.

For a scale factor that allows for 3% material shrinkage, use this formula:

$$\text{ScaleFactor} = \frac{1}{1 - .03} = \frac{1}{.97} = 1.0309$$

Enter the factor by pressing



Near Zero Warning


Each axis has its own near zero range. You can activate or deactivate the near zero warning feature by pressing the **Z** key. When the warning is activated, you can enter the range. Refer to page 12.

Tool Offset Definition

To determine the relative tool offsets, you can use either a tool presetter or the readout's *auto offset* feature. Use the **Z** key to select which method you plan to use.



Linear Error Compensation

The DRO 200T includes a linear error compensation feature that enables you to compensate for machine tool inaccuracies. You can have up to three different compensation segments per axis.


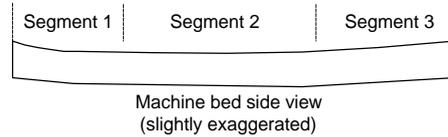


You will need a dial indicator and a measurement standard.

1. Enter the number of segments you will use. If you do not want to use any error correction, enter 0. Press **X** to start the first segment.
2. Position the standard in the center of the segment.
3. Press **Z**
4. Enter one edge of the standard.

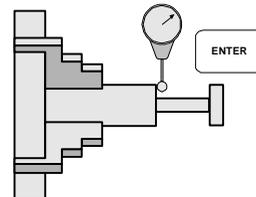
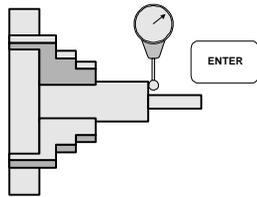


5. Enter the other edge of the standard.

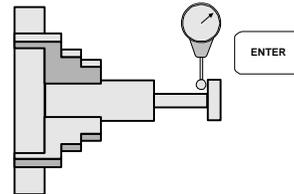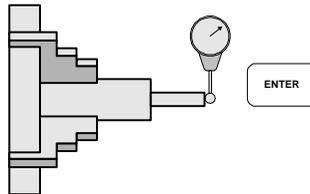

6. Enter the actual size of the standard, including the probe diameter if necessary.

If the display shows all dashes, refer to "Display Overflow Errors" on page 27.

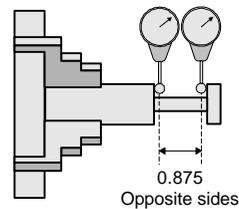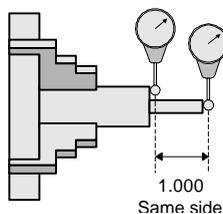

Press **X** for the next segment or, if all segments are done, the next axis.

Installation

IMPORTANT

Before installing the DRO 200T readout, record the serial number on the warranty card and return it to ACU-RITE INCORPORATED. The serial number label is located on the back of the readout.

Selecting a Location

Selecting a location for the readout is an important consideration for proper installation. Keep the following points in mind when selecting a safe and convenient location:

- The readout should be within reach of the operator for easy access to the keypad.
- The readout should be approximately at eye level.
- Avoid moving components or tools and minimize coolant splash or spray.
- The operating environment must be within the temperature range of 0° to 40° C (32° to 104°F) with a non-condensing relative humidity of 25% to 85%.

Proper Mounting

ACU-RITE has developed special mounting kits for the readout, which address the most common mounting requirements. Mounting kits include:

- Column and base machine mountings
- Hardware and mounting instructions

These kits are available from your factory authorized ACU-RITE Distributor or OEM/OEI.

If you fabricate a support device for the readout, it should be large enough and strong enough to accommodate the readout. It must also be stiff enough to minimize any vibration induced by machinery on the shop floor.

Connecting the Encoders

Insert the connector from each encoder into the mating connector on the back of the readout. Fasten it with a small screwdriver.

Encoder input 1 will be displayed in the readout's top display, input 2 in the next display, and input 3, if any, in the bottom display.

Provide enough slack in the encoder cables to allow for full travel of all machine axes. Check that machine movements will not pinch the cables. Use the cable tie-down hardware kits supplied with the encoders to fasten the cables neatly to the machine.

Connecting a Ground Wire

Connect a ground wire from the terminal on the back of the readout to the machine. The machine should also be connected to a solid earth ground. If not, be sure that the readout is.

Checking Voltage and Connecting Power




CAUTION


Connecting the readout to a power source outside of the acceptable range, or making an inappropriate setting with the voltage selector, may damage the readout, the encoders, or both.

Check that the voltage available at the power source is within specification before connecting it to the readout. If required, set the voltage selector to match the line voltage.


1. Remove the caution label from the input module, and use a thin-blade screwdriver in the slot at the top of the power-input module to open the module cover.

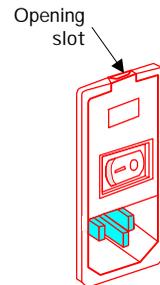

2. Pull the selection block out.

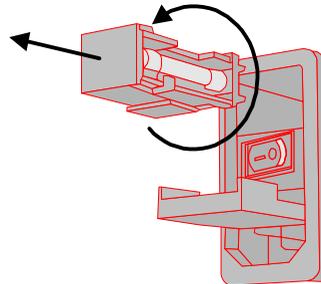

3. Remove the fuse, move the shorting bar to the other side, install the proper fuse, and push the block back into place.

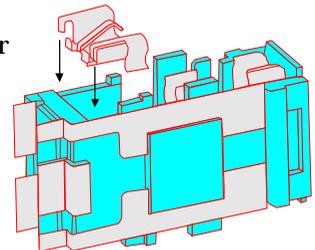

4. Close and snap the cover shut.

The voltage setting will show through the window in the voltage selection cover. Connect the readout to the power source using the power cord supplied.

Readout Specifications

Characteristic	Specification
Operating conditions	0° to 40°C (32° to 104°F) 25% to 85% relative humidity (non-condensing)
Storage conditions	-40° to 60°C (-40° to 140°F) 25% to 95% relative humidity (non-condensing)
Input requirements	Voltage: 115VAC or 230VAC (+/-20%), single phase Frequency: 47-63 Hz Current: 300ma @115V, 150ma @230V
Fuse	115V operation: ½ A, 250V, 3AG, Slo-blo 230V operation: ¼ A, 250V, 3AG, Slo-blo
Encoder input	Position signals: channels A & B TTL square wave signal in quadrature (90° nominal phase relationship) Maximum input rate: 50 kHz Reference signal: TTL square wave
Size	12.5"W x 5.125"D x 6.5H"
Weight	7.5 lbs.
Mounting	Bottom: two ¼ -20 threaded inserts
FCC compliance	Class A

Troubleshooting

This section is intended to provide you with some basic troubleshooting assistance with your readout system. If you cannot correct the problem after following these instructions, contact your authorized ACU-RITE distributor or OEM/OEI for repair or replacement procedures.

No Operation

NOTICE

If you turn power off, you must wait at least 5 seconds before turning it back on, or the readout may not power up. This is because the power supply, in order to withstand brief power outages and brownouts, requires several seconds to reset itself.

If the readout display will not operate, check the following conditions:

- **Check AC power source.** If the readout cannot be powered up, confirm that line voltage is present at the source and that the line voltage meets the required specifications.
- **Check power cord.** Remove the power cord at the electrical input module on the back of the readout. Determine if line voltage is present at this end of the cord.
- **Check fuse.** With the power cord removed, use a thin straight-blade screwdriver to remove the cover of the electrical input module. Refer to page 21. Slide out the fuse holder and check the fuse. If necessary, replace it. Replace the input module cover by snapping it back into place, and reconnect the power cord.



CAUTION

Replace fuses only with the specified type. Using incorrect fuses can present a safety hazard. The readout may also be permanently damaged. Refer to the Readout Specification chart on page 22 for the correct fuse.

Incorrect Operation

If system positioning does not seem to be repeatable, the problem could be with the machine tool or with the readout system.

- **Check the machine tool.** Check that the saddle is not locked. Ensure that the turret-to-column bolts are properly secured. Check the gib adjustments. Check spindle run-out.
- **Check linear encoders.** Check each encoder and reading head for proper installation. Ensure that the mounting brackets are secure.

If the system seems to be displaying incorrect positions, check the following items.

- **Verify presets.** Make sure the numbers you enter are correct.
- **Verify tool.** Check that the correct tool number is being used. Make sure the correct tool offset has been entered. Check the tool for wear.
- **Verify the scale factor.** Ensure that the correct scale factor is being used.
- **Verify linear error compensation.** Make sure that the factors used for linear error compensation are correct.

Power-On Self Test

There are four tests performed when power is applied to the readout. You will not notice these tests unless a problem is found, in which case a message will scroll across the display.

Keypad—a key was detected stuck down. The message will display what *row* (x) and *column* (y) the stuck key is in:

KEY STUCK – RxCy – PRESS CLEAR

Parameter memory—some of the system setup parameters are not valid. You may be able to check and reset these settings, but it's possible they will be lost again. The readout should be serviced as soon as possible.

MEMORY FAILURE [1] – PRESS CLEAR



CAUTION

Some working settings are not valid. Proceed with caution.

Working memory—the memory used by the readout for calculations is faulty. While it may be possible to use the readout, its position display and other information will not be reliable.

MEMORY FAILURE [2] – PRESS CLEAR



CAUTION

The readout cannot be relied on for correct operation if any memory failure is indicated. The readout should be serviced immediately.

Program memory—the memory used to store the software is faulty. While it may be possible to operate the readout, some functions will not work properly and incorrect information may be displayed.

MEMORY FAILURE [3] – PRESS CLEAR



CAUTION

The readout cannot be relied on for correct operation if any memory failure is indicated. The readout should be serviced immediately.

Internal Testing

Several internal tests may be performed to ensure that the readout is functioning properly. Tests are available for the internal memory, the keypad, and the display. In addition, the testing procedure reports the software version of the readout.

Begin the internal testing by holding down the  key for about 2 seconds. The software version will appear in the X-axis display

Keypad test. Begin by pressing the  key, and then press each key (except the  key) in turn to verify that it is functioning properly. When a key is pressed, the X-axis activates a “plus sign” indicator and increments a count. When you release the key, the plus sign disappears.

Display test. Begin by pressing the  key. All indicators in all displays will light. Visually check each portion of each display to ensure that they are functioning properly.

Press  again to test the display electronics. All decimal points on all displays will light momentarily, and then each segment of all displays will light in turn. Press  again, and each digit of all displays will light, one digit at a time, starting with the leftmost digit and moving to the right.

Exit the diagnostics by pressing the  key.

Other Errors

The readout includes built-in test and error-checking circuitry. This circuitry identifies errors that occur, and reports the problem to the operator. Errors are reported by scrolling messages in the X-axis display.

Loss of power is indicated by the “Power was off” message. Loss of power means that power to the readout has been interrupted. Since power to the encoders has also been interrupted, position information may no longer be accurate. Press the  key to clear the error message. All display measurements will be zeroed. Refer to page 4 for information about position recovery.

Counting errors are indicated by the “Scale miscount” message, telling you in which axis the miscount occurred. Counting errors result from distorted electrical signals from an encoder. These signals can be a result of an encoder malfunction, misalignment, mounting problems, or electrical interference. Press the  key to clear the error message. The axis display (for both absolute and incremental measurements) will be zeroed. Follow these steps to determine if your difficulties are associated with the readout or with the encoder.

- Ensure that the linear encoder connectors are correctly seated.
- Swap linear encoder cables at the readout to see if the problem still appears in the same display.

- If the problem remains in the same display, the readout is in error.
- If the problem follows the connection change, the linear encoder may be in error. Refer to the Checking the Linear Encoders section of your encoder reference manual.

Display overflow errors are indicated by dashes in all digits in an axis display. A numeric overflow occurs when the intended measurement is too large for the eight-digit display. Clear the error by returning the machine table into an area where measurements can again be displayed, selecting a lower display resolution, setting a new preset, or zeroing the display.

This error may also occur when using the automatic compensation routine while setting the LEC parameter. An error indicates that the calculated compensation factor was outside the acceptable range of -9999 to +9999, and usually is the result of incorrectly entering data. Clear the error and return to the beginning of the linear error compensation routine. Refer to page 18.

Data Logging

The readout collects information about itself while it is being used. This information is stored in memory for review at a later time.

Press and hold the  key until the software version is displayed. Then press the  and  keys simultaneously. Use the  key to cycle through the following information.

Power on time—displayed in decimal hours.

Scale travel distance—the travel distance for each axis is scrolled one after the other.

Last 3 errors—the most recent three errors are remembered and messages for the errors are scrolled one after the other.



**ACU-RITE Readout Systems are
manufactured in the USA**

ACU-RITE IS AN
ISO 9001
CERTIFIED
MANUFACTURER

ACU-RITE[®]

ACU-RITE INCORPORATED
ONE PRECISION WAY
MASON INDUSTRIAL PARK
JAMESTOWN, NEW YORK 14701